
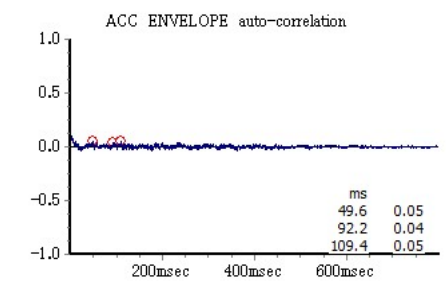
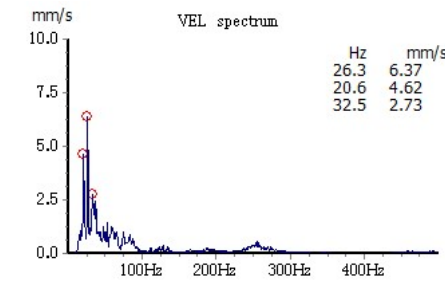
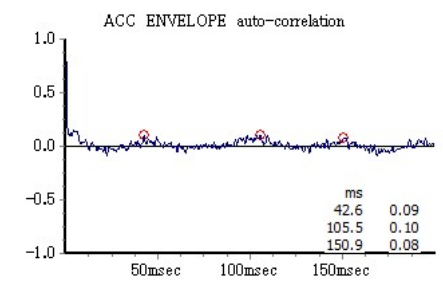
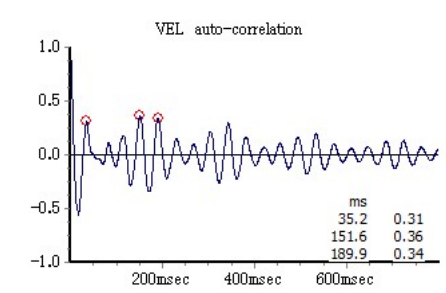
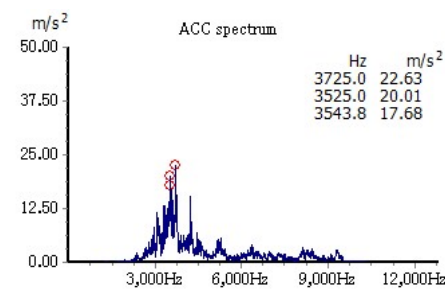
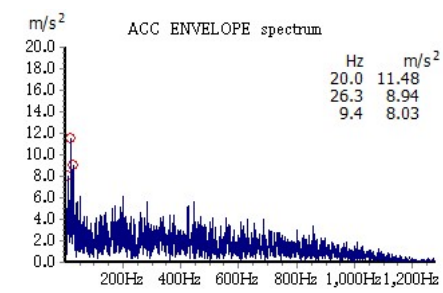
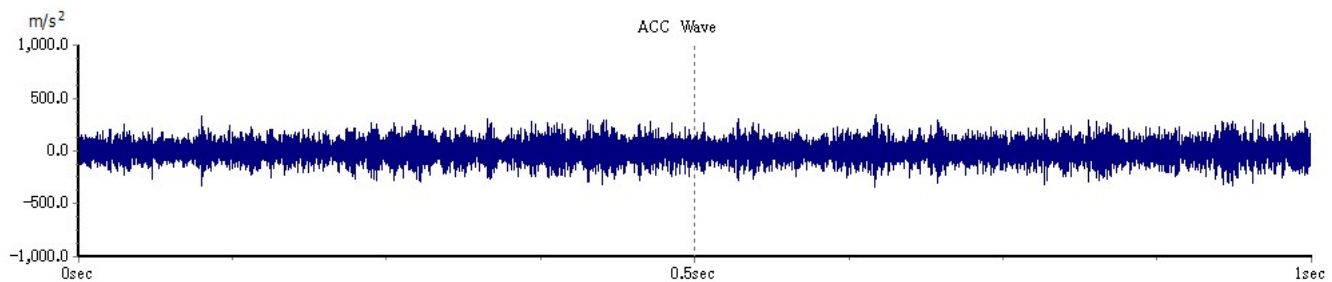
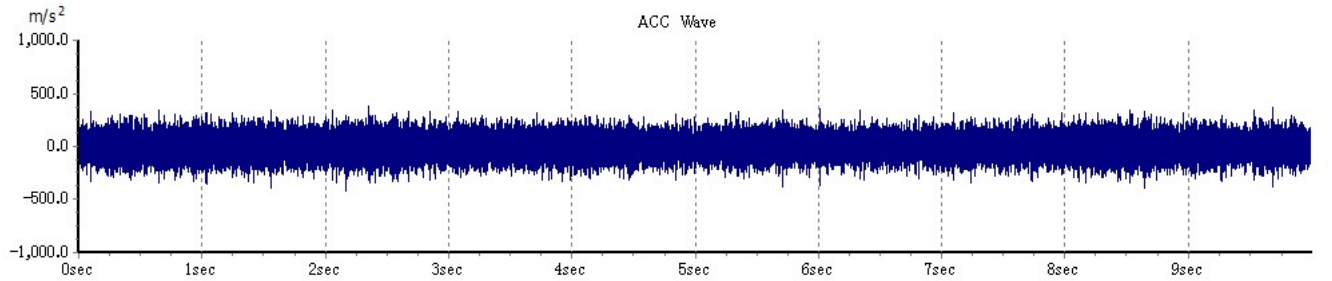
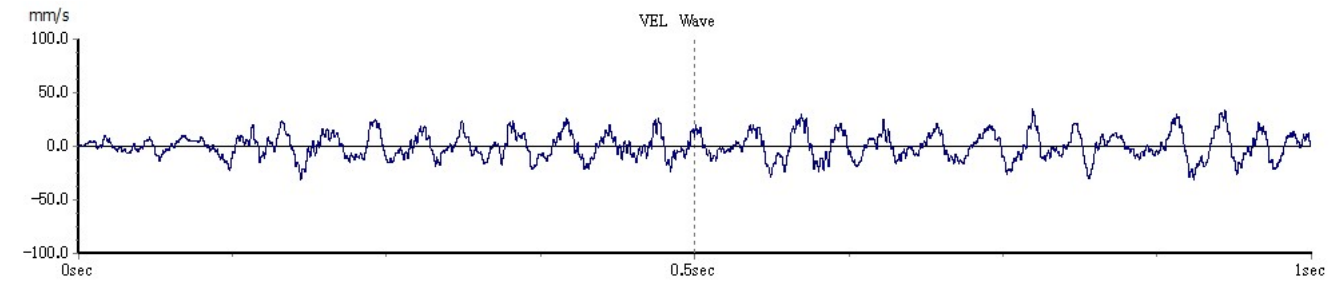


**Analysis data**  
振動診断カルテ

部位/方向 04H 症状/異常原因

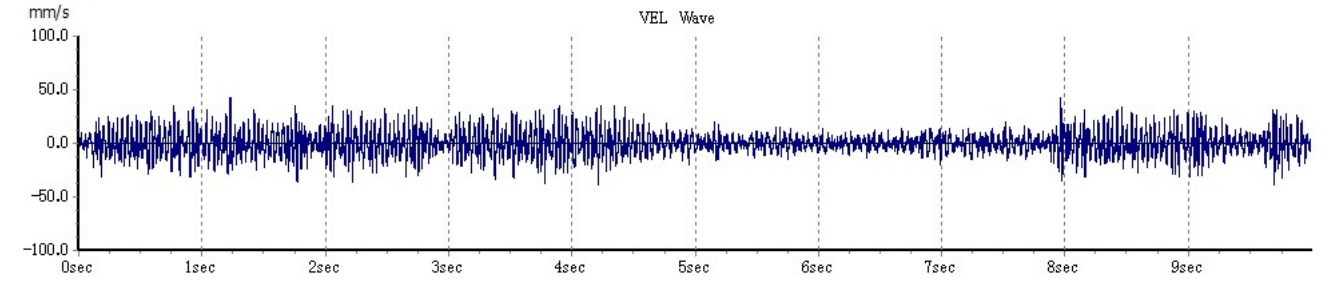

軸受No. 6208C3

諸元計算値

回転 :fr	回転 :2fr	内輪 :fi	外輪 :fo	転動体:fb	転動体:2fb	保持器:fc	Z数成分:fp
20.62 Hz	41.23 Hz	111.19 Hz	74.36 Hz	49.88 Hz	99.77 Hz	8.26 Hz	82.47 Hz
48.50 ms	24.25 ms	8.99 ms	13.45 ms	20.05 ms	10.02 ms	121.03 ms	12.13 ms